

## **Application Advisory**

### **IR Troubleshooting Guide**

**NOTE:** Due to the many variables in a given installation, the troubleshooting countermeasures you will have to take may vary from job to job. Each installation is different due to the number of IR receivers in use, length of wire runs, type of wire, amount of ambient IR noise present, etc.... Therefore, your countermeasures for a particular job will range from nothing at all, to any combination of the solutions listed below.

#### Please Click on the Link below that best describes your symptom:

i lease offer off the Ellik below that best describes your symptom.
Symptom #1: DIM or NO Talk Back LED during IR Reception or reduced operational range
Symptom #2: TB LED on IR Receiver (and/or Emitters) Dimly lit or flickering
Symptom #3: TB LED on IR Receiver (and/or Emitters) on solid
Symptom #4: TB LED on IR Rec. blinks but 283M or 286M 'Blink' style Emitters do not
Symptom #5: Intermittent IR control (I.e. buttons on remote need to be pressed multiple
times)
Symptom #6: Emitters function but some (or all) components do not respond.
<b>Symptom #7:</b> Absolutely No Functionality (How to determine which component is at fault)

**Model #'s** IR Receivers: Model #'s 291, 480, 490, & 780 Series Receivers

### Symptom #1:DIM or NO Talk Back LED during IR Reception or reduced operational range

	<u>Cause:</u>	<u>Solution</u>
1.	Weak Batteries in Transmitting Remote.	Replace batteries.
2.	Bad Emitter or no emitter plugged into connecting block.	Test emitter and verify wiring.
3.	Signal wire between IR Receiver and the Connecting Block is open.	Recheck wiring.
4.	Power Supply not putting out proper voltage.	Verify supply is a 12VDC regulated supply reading between 11.5 to 13VDC under load. Should be using Power Supply Model 781RG (12VDC Regulated, 200mA) or 782-00 (12VDC Regulated, 1.2A)
5.	Output from the IR receiver/connecting block is connected to a high impedance IR input jack on a component.	If you are using a passive connecting block, such as a 789-44, and the system is not working, try the amplified connecting block, model 791-44. Put one of the small plastic case jumpers supplied with the block on the pins next to the emitter jack. This will provide the IRin jack on the component with a hotter signal.



# **Xantech**Application Advisory

6.	IR Receiver is inoperable.	Replace Receiver.
7.	on same COAX Line anywhere between the	Need to use a Bypass Kit (model BYPASS94 Kit) to route the IR control signals around the amplifier(s).

### Symptom #2: TB LED on IR Receiver (and/or Emitters) Dimly lit or flickering

	Cause:	<u>Solution</u>
1.	Signal and ground <b>wires</b> are <b>reversed</b> or shorted either at the connecting block or IR receiver.	Recheck your wiring.
2.	Defective emitter.	Replace Emitter
3.	Relatively high levels of <b>ambient noise</b> . This can be due to any of the following: Sunlight, florescent Lighting or Plasma Displays.	In this case use either a SUN filter (SUN480, SUN490, SUN780), or any of our 'CFL Friendly' IR Receivers (291-80, 480-80, 780-80). For Plasma Interference use the 490-90 or 780-90 'Plasma Friendly' IR Receivers. These can also be used in direct sunlight and in the presence of 'tube style' florescent lighting.
4.	<b>EMI</b> induced noise. This can be due to light dimmer controls or other radiating electronic devices (PC's or any poorly shielded electronic device).	Reposition IR Receiver and/or cabling away from emitting device. You can also place a 4700hm resistor in parallel with the IR Signal and GND connections on the connecting block. This will also help alleviate any stray capacitance in the cable.
5.	Plasma Interference	Use a 490-90 Plasma 'Friendly' IR Receiver. If already using a 490-90 unit, please note the Plasma interference can be reflected off of any item it comes into contact with within approx. 3ft. From the front of the display. Keeping this in mind, make sure that the 490-90 is free from any obstruction that might reflect back into the receiving eye.



### **Symptom #3:** TB LED on IR Receiver (and/or Emitters) on solid

	Cause:	Solution
1.	Plasma Interference	Use a 490-90 Plasma 'Friendly' Receiver. If already using a 490-90 unit, please note the Plasma interference can be reflected off of any item it comes into contact with within approx. 3ft. From the front of the display. Keeping this in mind, make sure that the 490-90 is free from any obstruction that might reflect back into the receiving eye.
2.	Voltage and Ground wires are reversed at the connecting block or IR Receiver	Recheck your wiring.
3.	Relatively high levels of <b>ambient noise</b> . This can be due to any of the following: Sunlight, florescent Lighting or Plasma Displays.	In this case use either a SUN filter (SUN480, SUN490, SUN780), or any of our 'CFL Friendly' IR Receivers (291-80, 480-80, 780-80). For Plasma Interference use the 490-90 or 780-90 'Plasma Friendly' IR Receivers. These can also be used in direct sunlight and in the presence of 'tube style' florescent lighting.
4.	dimmer controls or other radiating electronic devices (PC's or any poorly shielded	Reposition IR Receiver and/or cabling away from emitting device. You can also place a 4700hm resistor in parallel with the IR Signal and GND connections on the connecting block. This will also help alleviate any stray capacitance in the cable.
5.	Power Supply not putting out proper voltage.	Verify supply is a 12VDC regulated supply reading between 11.5 to 13VDC under load.



## **Application Advisory**

### Symptom #4: TB LED on IR Rec. blinks but 283M or 286M 'Blink' style Emitters do not

	Cause:	Solution
	There may be a short, such as a staple driven through the Signal and GND wires of the IR Receiver and/or the emitter.	Recheck your wiring.
2.	ieminar may na chonan iniamaily	Replace Emitter or use TEST EMITTER to check circuit.
3		Place a DC Blocker (Model 203-00) on any TV Leg without IR Receiver

### **Symptom #5:Intermittent IR control** (I.e. buttons on remote need to be pressed multiple times)

	Cause:	Solution Solution
1.	Plasma Interference	Use a 490-90 Plasma 'Friendly' Receiver
2.	Relatively high levels of <b>ambient noise</b> . This can be due to any of the following: Sunlight, florescent Lighting or Plasma Displays.	In this case use either a SUN filter (SUN480, SUN490, SUN780), or any of our 'CFL Friendly' IR Receivers (291-80, 480-80, 780-80). For Plasma Interference use the 490-90 or 780-90 'Plasma Friendly' IR Receivers. These can also be used in direct sunlight and in the presence of 'tube style' florescent lighting.



## **Application Advisory**

Long Wire Runs – shielded wire typically of 100 feet (30 meters) or longer causes a filter effect due to accumulated capacitance of the wire. Intermittent, or no IR control, could actually be because of the longer wire runs.

Putting a 470-ohm resistor in parallel at the connecting block between signal and ground will effectively discharge the capacitance of the wire. This will allow the signal to travel farther on shielded wire. Adding a resistor between the input and ground of the connecting block will drop the IR level down somewhat. Passive connecting blocks, such as the 789-44, may not have enough signal output for consistent control of the equipment. You may have to upgrade to an amplified connecting block to bring the IR level back to normal. In these cases, the 791-44 would be an ideal connecting block for single zone systems while the 795-20 would work best for a 2-4 zone system.

### Symptom 6: Emitters function but some (or all) components do not respond.

	Cause:	<u>Solution</u>
1.	Emitter placement is incorrect.	Reposition the Emitter so that it is directly over the components sensor window. Consult the components owners manual of the unit for the exact location of the IR Sensor Window.
2.	overpowering the unit or there is bleed- through from other emitters close by	Reposition the Emitter to a position that is suitable for the unit. Use a 283 or 286M Blink style emitter (they have a lower output than non-blink emitters 282 and 284M). If the components do not need to be controlled directly without an IR Repeater system (components are located in an equipment closet), place a Mouse Emitter Shield cover over the Emitter (PN#MS1). The rounded (nonstick) side of the emitter is a hi-output side and can reflect off other devices and overpower some components IR Sensors. If using a CB12 connecting block, try a 789-44 connecting block. This has a series resistor at the output, which will limit current to the Emitter.



3.

## **Application Advisory**

Using a CFL-Friendly IR Receiver (291-80, 480-80, or 780-80) and trying to control a unit with a carrier frequency greater then 40kHz (I.e. RCA DSS, Scientific Atlanta, Jerald, and General Instruments Cable or DSS Set Top Boxes).

If you are using the 291-80 or 780-80 CFL Friendly receiver, locate the Carrier Frequency Adjustment on the unit and using a small blade screwdriver, (3/32" blade width max.) rotate the adjustment for best performance of all the units in the system. **Note:** The 480-80 version does not have this feature; you will either need to change the unit to a 291-80, 780-80 or the 490-90. The 490-90 is a wide band unit and will not require any frequency adjustment.

### **Symptom #7:** Absolutely No Functionality (How to determine which component is at fault)

Step:	Component to Test	<u>Instructions</u>
1.	Verify Power Supply	With a Multimeter, measure the DC Voltage of the supply while it is connected to the Connecting Block. Put the Negative lead of the meter on the terminal marked GND and the Positive Lead on the terminal marked 12VDC (or V). You should get a reading between 11.5VDC and 13.0VDC. If not, remove the supply from the Connecting block and measure again this time directly on the 2.5mm Coaxial plug. If it reads between 11.5VDC and 13VDC, power supply is most likely good. Reconnect to the Connecting Block and proceed to step 2. NOTE: In most cases this will indicate the supply is good but in some cases the supply can still be bad (i.e. reads good when not plugged in but may not be able to handle the current load of the system.)



2.	Verify Emitter. (283M or 286M <b>Blink</b> Style ONLY)	Remove the power supply from the connecting block and all Emitters from the output. Place a jumper wire on the connecting block between IR and +12v. Reconnect the Power Supply and <b>one</b> emitter. The Emitter should Light bright and solid. Repeat for all emitters.
3.	Blink Style)	Use a diode tester to verify proper Emitter operation. Remove Emitter from Connecting Block. Place the Positive Lead of the tester on the TIP of the Mono Mini Plug and the Negative Lead on the Shield of the Mono Mini Plug. Meter should read a voltage. When the leads are reversed (Positive lead on Shield and Negative lead on TIP) you should not get any voltage reading at all.
4.	Verify IR Receiver.	Remove the power supply from the connecting block and all Emitters from the output. Place a jumper wire on the connecting block between IR Signal and GND. Reconnect the Power Supply. With a known good hand-held remote, shoot a constant IR Command at the receiver and verify the TB LED on the Receiver lights.