

Assemblies Affected: PA635

Symptom: PA635 Amplifier is not able to be controlled by IR under Code Group setting B0 as stated in the Manual.

Cause: All PA635's are shipped with Default Code Group A0.

Set Dials on the rear of the RC68+ to A0 to control or if programming a Xantech IR Component with Dragon Drop-IR™ Software, do the following: (See Figures below).

1. Click on Palettes and select RC68+ Command Palette (or hit F5 on your keyboard).
2. Click on the OPTIONS Tab
3. Select PA635 from the Xantech Model Drop-Down Window.
4. Set the Code Group setting located at the top to A 0.

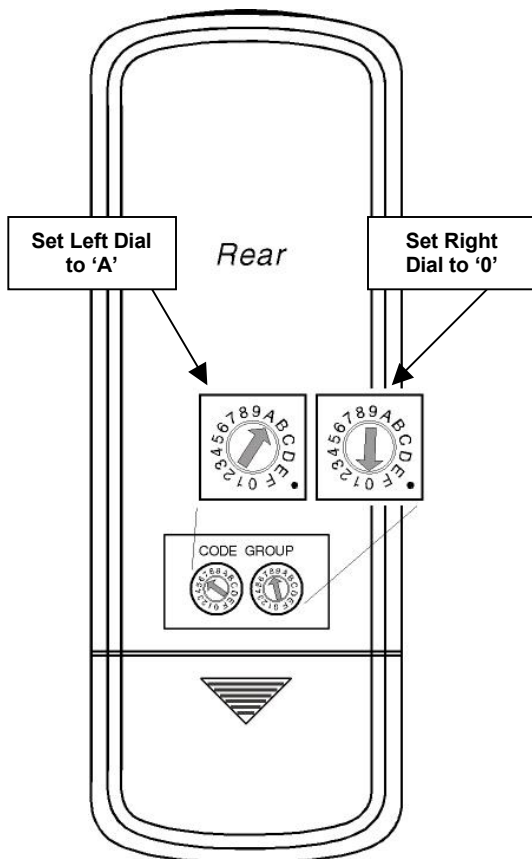


Fig. 1: RC68+ Programmer Settings

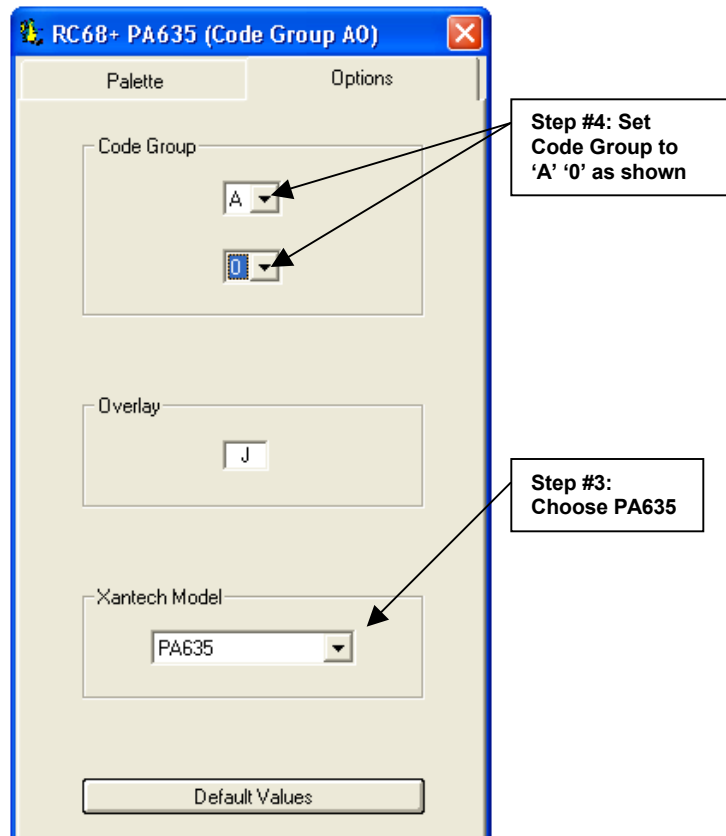


Fig. 2: Dragon Drop-IR™ RC68+ Command Palette Settings